

CARDONE™ ProTech®

Supporting Today's Vehicle Technician




Improper Placement of Fitting O-ring Results in No Pressure

Application All vehicles equipped with power steering.

Problem No pressure output from power steering pump after installation of a new O-ring on the power steering pressure fitting.

Cause Incorrect placement of O-ring on the pressure fitting, blocking the flow of fluid from the bypass hole to the flow control valve. This causes a no-pressure condition.

Solution Install the replacement O-ring in the correct position on the fitting. Also make sure piston is moving freely in bore, a stuck piston will cause the same problem.

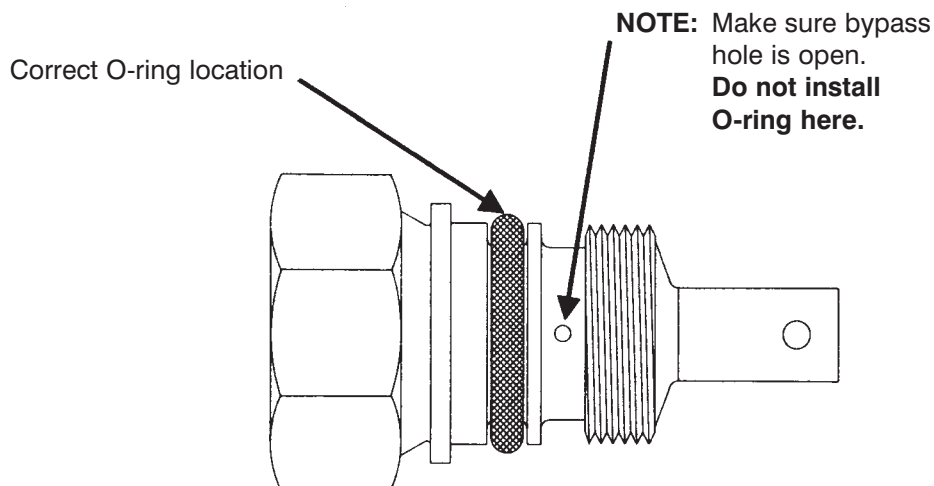

Note See instruction sheet 93-0347-20.